



Master AD/SI Report

525B - CJ3  
S/N 525B-0098 N87VM

<b>OWNER:</b> SWIFT PROPERTIES L.L.C.		<b>OPERATOR:</b> SWIFT PROPERTIES L.L.C.	
<b>ADDRESS:</b> 7352 AUTOPARK DRIVE HUNTINGTON BEACH CA 92648		<b>ADDRESS:</b> 7352 AUTOPARK DRIVE HUNTINGTON BEACH CA 92648	
<b>PHONE:</b>		<b>PHONE:</b>	
<b>FAX:</b>		<b>FAX:</b>	
<b>ANALYST:</b> CJ03 ANALYST		1-316-462-2464 (DIRECT)	800-787-9749 (EFAX-CARDS)
<b>EMAIL:</b> KDUMCUM@CAMPSYSTEMS.COM		1-866-581-2267 (OFFICE)	631-980-4222 (EFAX-CARDS)
		WWW.CAMPSYSTEMS.COM	PLEASE RECORD CHANGES TO ADDRESS, LAST ACTUALS (IF ANY) AND FAX THIS SHEET BACK TO CAMP.

**Filter Criteria:** Task Type In: ('AD','ADP'); Group by Profile or Bulletin: Profile Type; Mode: With Compliance or Next Due; For: Airframe,Engine,APU Etc;

<b>AIRCRAFT</b>	<b>SERIAL/REGNO:</b> 525B-0098/N87VM	<b>MODEL:</b> 525B - CJ3	<b>MANUFACTURER:</b> TEXTRON AVIATION INC.
-----------------	--------------------------------------	--------------------------	--

DATES		LAST ACTUALS		CURRENT ACTUAL	
CERTIFICATION DATE: 04-AUG-2006		2439.1 A/C HRS	as of 05-DEC-2023	_____ A/C HRS	as of ____/____/_____
		2058 AFL	as of 05-DEC-2023	_____ AFL	as of ____/____/_____
		1055.3 ACH	as of 24-OCT-2023	_____ ACH	as of ____/____/_____

<b>ENGINE NO. 1</b>	<b>SERIAL/PART:</b> 141203/67000-200	<b>MODEL:</b> FJ44-3A/-3A-24	<b>MANUFACTURER:</b> WILLIAMS INTERNATIONAL
---------------------	--------------------------------------	------------------------------	---

INSTALLED ON 04-AUG-2006		LAST ACTUALS		CURRENT ACTUAL	
1 ENG. HRS	1 A/C HRS	2439.1 ENG. HRS	as of 05-DEC-2023	_____ ENG. HRS	as of ____/____/_____
ENC		2058 ENC	as of 05-DEC-2023	_____ ENC	as of ____/____/_____

<b>ENGINE NO. 2</b>	<b>SERIAL/PART:</b> 141204/67000-200	<b>MODEL:</b> FJ44-3A/-3A-24	<b>MANUFACTURER:</b> WILLIAMS INTERNATIONAL
---------------------	--------------------------------------	------------------------------	---

INSTALLED ON 04-AUG-2006		LAST ACTUALS		CURRENT ACTUAL	
1 ENG. HRS	1 A/C HRS	2439.1 ENG. HRS	as of 05-DEC-2023	_____ ENG. HRS	as of ____/____/_____
ENC		2058 ENC	as of 05-DEC-2023	_____ ENC	as of ____/____/_____



## Master AD/SI Report

525B - CJ3 S/N 525B-0098 (N87VM): 2439.1HRS, 2058 AFL as of 05-Dec-2023

**AIRCRAFT**  
**AD with Compliance or Due**  
**Report Date: 06-Dec-2023**

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
AIRFRAME - AD - 525B-0098/N87VM							
FAA 2005-17-11	PREVENT INCORRECT INSTALLATION OF WIRES TO THE ENGINE FIRE EXTINGUISHER BOTTLES					MANDATORY	COMPLIED WITH
		MOS		04-AUG-2006			
		HRS/MSC A/R		7			
		AFL		0			
FAA 2008-03-10	INSPECT THE LOWER WING SKIN STRUCTURE, FORWARD WING SPAR, LOWER FUSELAGE SKIN, FAIRINGS, AND THE EXTERNAL FAIRING FRAMES FOR CORROSION; REPAIR ANY DAMAGE FOUND; APPLY A CORROSION INHIBITIVE SEALANT TO THE FUSELAGE FAIRINGS BEFORE REINSTALLING; AND DISABLE THE COCKPIT MOUNTED PILOT RELIEF TUBE					AIRWORTHINESS	COMPLIED WITH
		MOS		06-APR-2008			
		HRS/MSC A/R		335			
		AFL					
FAA 2010-04-16	TYPE H1-10 AIR HALON 1211 (BCF) PORTABLE FIRE EXTINGUISHERS MANUFACTURED BY SICLI					MANDATORY	NOT APPLICABLE - N/A BY TYPE EXTINGUISHER. AMEREX C352 EXTINGUISHERS INSTALLED. TRANS.
		MOS		20-APR-2010			
		HRS/MSC A/R		684			
		AFL		513			
FAA 2014-18-01	NAVIGATION - ROCKWELL COLLINS, INC. MODE S TRANSPONDERS - INSPECTION / MODIFICATION					MANDATORY	COMPLIED WITH - COMPLIED WITH AD 2014-18-01 BY INSPECTION. PINS 20, 21, 22, AND 23 OPEN AND SET TO CODE 0. NO ADS-B INSTALLED. NO FURTHER ACTION NECESSARY.
		MOS		06-JUL-2016			
		HRS/MSC -		1620.2			
14-OCT-2014		AFL		1328			
		ACH		699.4			
FAA 2021-08-07 PARA (G)(1)	REPLACE EACH GPS-4000S GPS P/N 822-2189-100 WITH A GPS THAT DOES NOT HAVE P/N 822-2189-100					MANDATORY	COMPLIED WITH - REMOVE P/N 822-2189-100 S/N 26WGD AND INSTALLED P/N 822-2189-101 S/N 3LNVV. AD NO LONGER APPLIES BY PART NUMBER.
		MOS		07-DEC-2022			
		HRS/MSC -		2322.2			
		AFL		1953			
FAA 2023-10-02 PARA (I)	REVISE THE LIMITATIONS SECTION AND REMOVE THE AFM REVISION REQUIRED BY PARA (H) (AFTER 30 JUN 2023)					MANDATORY	COMPLIED WITH - COMPLIED WITH AD 2023-10-02 BY INCORPORATING THE LIMITATIONS SPECIFIED IN FIGURE 4 TO PARAGRAPH (I) OF THIS AD AND REMOVED THE AFM REVISION REQUIRED BY PARAGRAPH (H) OF THIS AD.
		MOS		01-JUL-2023			
		HRS/MSC -		2392.7			
		AFL		2023			



# Master AD/SI Report

525B - CJ3 S/N 525B-0098 (N87VM): 2439.1HRS, 2058 AFL as of 05-Dec-2023

**AIRCRAFT**  
**AD with Compliance or Due**  
**Report Date: 06-Dec-2023**

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
APPLIANCE - 525B-0098/N87VM							
FAA 1997-05-03 R01	APPLIANCE AD - ALLIEDSIGNAL GNS-XLS & GNS-XL					MANDATORY	NOT APPLICABLE - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS		04-AUG-2006			
		HRS/MSC	A/R	7			
		AFL		0			
FAA 1998-25-02	APPLIANCE AD - BFGOODRICH SKYWATCH SKY497					MANDATORY	NOT APPLICABLE - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS		04-AUG-2006			
		HRS/MSC	A/R	7			
		AFL		0			
FAA 1998-25-10 R01	APPLIANCE AD - AIRCRAFT BELTS INC					MANDATORY	NOT APPLICABLE - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS		04-AUG-2006			
		HRS/MSC	A/R	7			
		AFL		0			
FAA 1999-08-21	APPLIANCE AD - PURITAN-BENNETT AERO SYSTEM C					MANDATORY	NOT APPLICABLE - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS		04-AUG-2006			
		HRS/MSC	A/R	7			
		AFL		0			
FAA 2001-23-17	APPLIANCE AD - GARMIN GNS 430					MANDATORY	NOT APPLICABLE - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS		04-AUG-2006			
		HRS/MSC	A/R	7			
		AFL		0			
FAA 2002-20-09	APPLIANCE AD - COLLINS AFD-3010 AFD UNITS					MANDATORY	COMPLIED WITH
		MOS		04-AUG-2006			
		HRS/MSC	A/R	7			
		AFL		0			
FAA 2004-08-15	APPLIANCE AD - TAWS 8000 TERRAIN AWARENESS					MANDATORY	NOT APPLICABLE - NOT APPLICABLE-EQUIPMENT NOT INSTALLED
		MOS		04-AUG-2006			
		HRS/MSC	A/R	7			
		AFL		0			
FAA 2004-10-15	APPLIANCE AD - GTX330/330D SOFTWARE UPGRADE					MANDATORY	COMPLIED WITH
		MOS		04-AUG-2006			
		HRS/MSC	A/R	7			
		AFL		0			
FAA 2012-02-08	APPLIANCE AD - AVIATION COMMUNICATION AND SURVEILLANCE SYSTEMS (ACSS) TRAFFIC ALERT AND COLLISION AVOIDANCE SYSTEM (TCAS) UNITS					MANDATORY	NOT APPLICABLE - AD 2012-02-08 N/A. AVIATION COMMUNICATION AND SURVEILLANCE SYSTEMS EQUIPMENT NOT INSTALLED IN A/C
		MOS		26-FEB-2015			
13-MAR-2012		HRS/MSC	-	1449.6			
		AFL		1157			



# Master AD/SI Report

525B - CJ3 S/N 525B-0098 (N87VM): 2439.1HRS, 2058 AFL as of 05-Dec-2023

**AIRCRAFT**  
**AD with Compliance or Due**  
**Report Date: 06-Dec-2023**

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2015-08-07	APPLIANCE AD - OXYGEN - ZODIAC AEROTECHNICS (FORMERLY INTERTECHNIQUE AIRCRAFT SYSTEMS) FLIGHTCREW OXYGEN MASK REGULATORS - INSPECTION / REPLACEMENT OF INFLATABLE HARNESSSES					MANDATORY	NOT APPLICABLE - AD 2015-08-07 N/A BY DATE OF MANUFACTURE OF MASK AND SERIAL NUMBER PER BE SB MXH-35-240.
16-JUN-2015		MOS HRS/MSC - AFL ACH		06-JUL-2016 1620.2 1328 699.4			
FAA 2015-08-07 PARA (G)	INSPECT THE INFLATABLE HARNESS FITTED TO EACH FLIGHTCREW OXYGEN MASK REGULATOR TO DETERMINE IF THE INFLATABLE HARNESS IS INSTALLED WITH A PART NUMBER AND A BATCH NUMBER IDENTIFIED IN APPENDIX I OF ZODIAC AEROSPACE SERVICE BULLETIN MXH-35-240, REVISION 7, DATED SEPTEMBER 1, 2011					MANDATORY	NOT APPLICABLE - AD 2015-08-07 N/A BY DATE OF MANUFACTURE OF MASK AND SERIAL NUMBER PER BE SB MXH-35-240.
16-JUN-2015		MOS HRS/MSC - AFL ACH		06-JUL-2016 1620.2 1328 699.4			
FAA 2015-08-07 PARA (H)	REPLACE THE INFLATABLE HARNESS IDENTIFIED IN PAPRGRAPH G WITH A NEW OR RE-IDENTIFIED HARNESSSES					MANDATORY	NOT APPLICABLE - AD 2015-08-07 N/A BY DATE OF MANUFACTURE OF MASK AND SERIAL NUMBER PER BE SB MXH-35-240.
16-JUN-2015		MOS HRS/MSC - AFL ACH		06-JUL-2016 1620.2 1328 699.4			
FAA 2015-23-09	APPLIANCE AD - OXYGEN - ZODIAC AEROTECHNICS (FORMERLY INTERTECHNIQUE AIRCRAFT SYSTEMS) FLIGHT CREW OXYGEN MASK REGULATORS - INSPECTION / REPLACEMENT OF OXYGEN MASK REGULATORS					MANDATORY	NOT APPLICABLE - AD 2015-23-09 NOT APPLICABLE BY P/N AND S/N.
28-DEC-2015		MOS HRS/MSC - AFL		09-DEC-2015 1576.5 1285			
FAA 2015-23-09 PARA (G)	INSPECT EACH FLIGHTCREW OXYGEN MASK REGULATOR TO IDENTIFY THE PART NUMBER AND SERIAL NUMBER					MANDATORY	NOT APPLICABLE - AD 2015-23-09 NOT APPLICABLE BY P/N AND S/N.
28-DEC-2015		DAYS HRS/MSC - AFL		09-DEC-2015 1576.5 1285			
FAA 2015-23-09 PARA (H.1)	REPLACE EACH AFFECTED FLIGHTCREW OXYGEN MASK WITH A PART IDENTIFIED IN PARAGRAPH (H)(1)(I) OR (H)(1)(II).					MANDATORY	NOT APPLICABLE - AD 2015-23-09 NOT APPLICABLE BY P/N AND S/N.
28-DEC-2015		DAYS HRS/MSC - AFL		09-DEC-2015 1576.5 1285			
FAA 2015-23-09 PARA (H.2.I)	REVISE THE EMERGENCY PROCEDURES SECTION OF THE AIRPLANE FLIGHT MANUAL (AFM) BY INSERTING THE STATEMENT PROVIDED IN FIGURE 1					MANDATORY	NOT APPLICABLE - AD 2015-23-09 NOT APPLICABLE BY P/N AND S/N.
28-DEC-2015		DAYS HRS/MSC - AFL		09-DEC-2015 1576.5 1285			
FAA 2015-23-09 PARA (H.2.II)	FABRICATE AND INSTALL A PLACARD ON THE FLIGHTCREW OXYGEN MASK CONTAINER THAT STATES: "USE SELECTOR ON 100% OR EMERGENCY ONLY."					MANDATORY	NOT APPLICABLE - AD 2015-23-09 NOT APPLICABLE BY P/N AND S/N.
28-DEC-2015		DAYS HRS/MSC - AFL		09-DEC-2015 1576.5 1285			