

Elliott Aviation of the Quad Cities - MLI
PO Box 100
Moline, Illinois, 61266-0100
Tel: 309-799-2010
Fax: 309-799-2000

Date: 9/8/17

King Air Series Inspection Report

Customer: Bramco, LLC

Model: B-200

Serial No: BB-1920

Work Order No: 2517213

In talking with Bramco here is a high level list of what my understanding of the repairs are:


- the left engine has been inspected and repaired. **Complete. See Left Engine (S/N PCE-PJ0915) Log Entry dated 3/29/17.**
- the left and right props has been overhauled. **Complete. See Prop Log books both left and right. Entries dated 06APR2017 and 07APR2017.**
- the landing gear (right) has been inspected and repaired. **Complete. 6-year Inspection completed. Will be signed off at aircraft release from Elliott Aviation.**
- 6-year inspection and heavy overhaul completed on all landing gear. **Complete. 6-year Inspection completed. Will be signed off at aircraft release from Elliott Aviation.**
- Structural repairs to right engine nacelle and structure is currently undergoing repair. **In-work. Structure repairs are mostly complete. Awaiting final installation of the wing and all function-checks and leak-checks.**
- Phase inspections are ongoing. **Currently undergoing a Phase 1 and 2.**

Elliott Aviation of the Quad Cities



Initial Visit to the Aircraft in March 2017.

Elliott Aviation of the Quad Cities

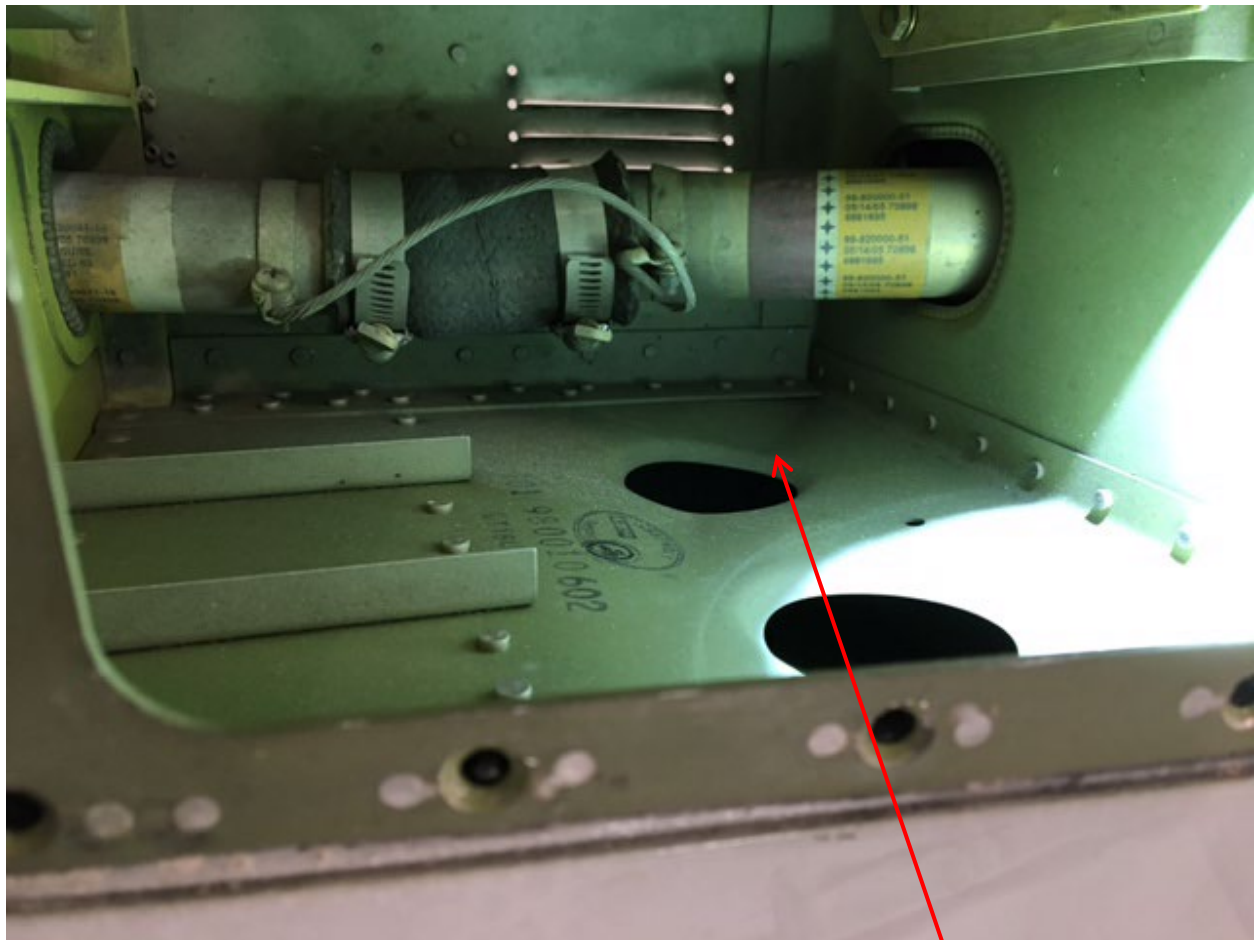


Wrinkled web in Inverter bay area. Replaced.




Wheel Well Outboard Keel Wrinkles, RH. Replaced.

Elliott Aviation of the Quad Cities

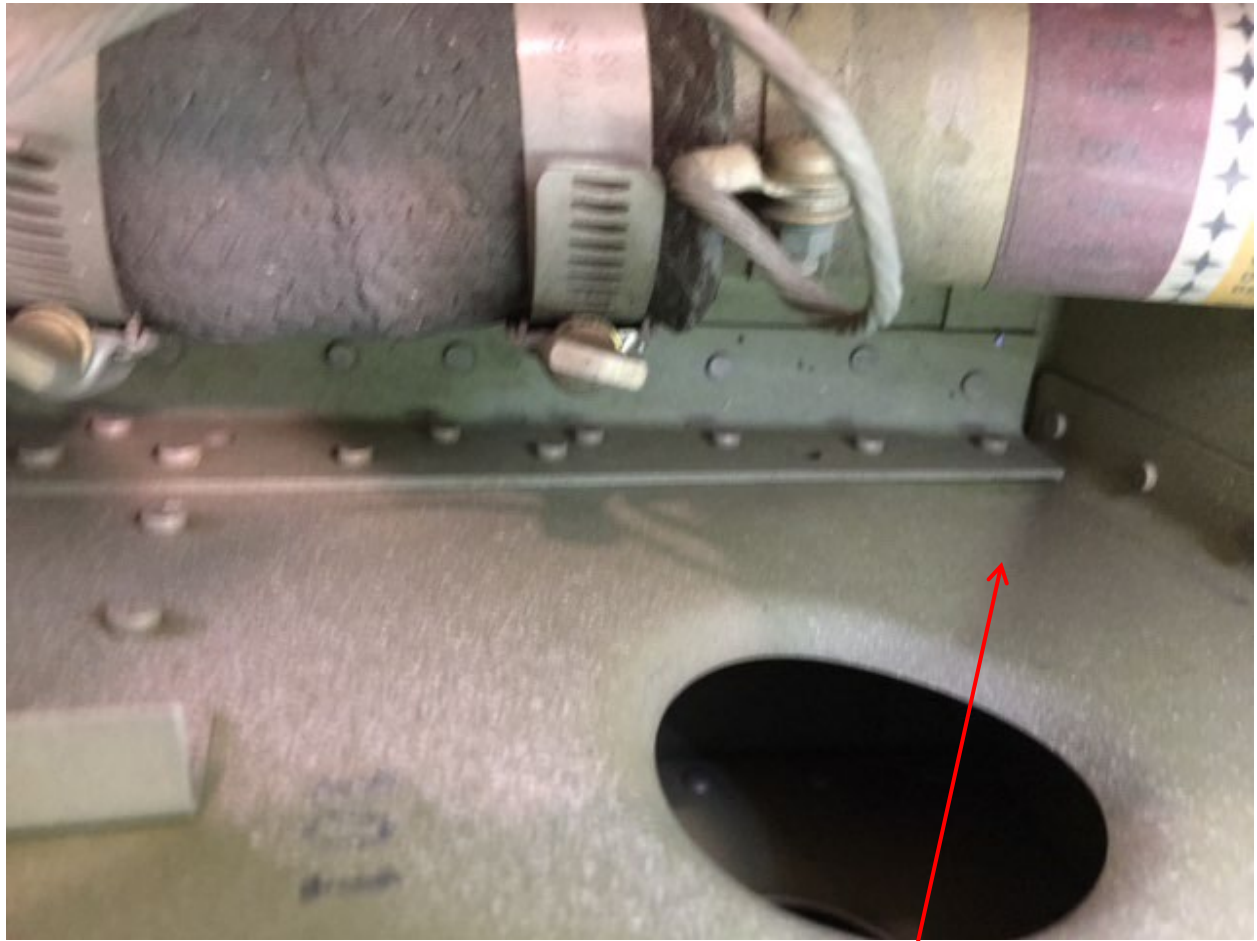

Inverter panel web wrinkle. Replaced.

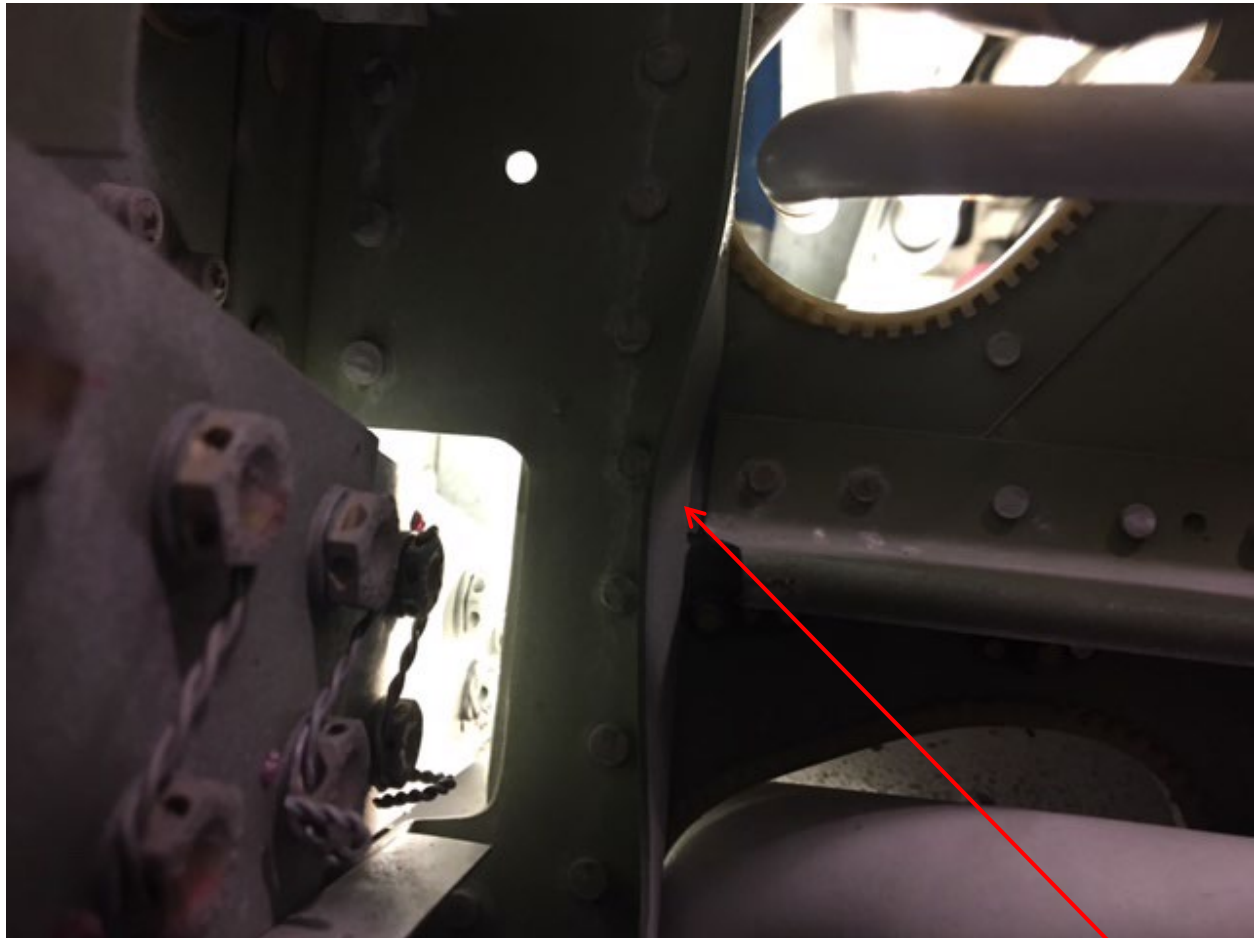


Deformed stiffener where wing attach fitting passes through Keel. Replaced.




Deformed Structure in wheel well area, RH. Reformed with keel replacement.

Elliott Aviation of the Quad Cities

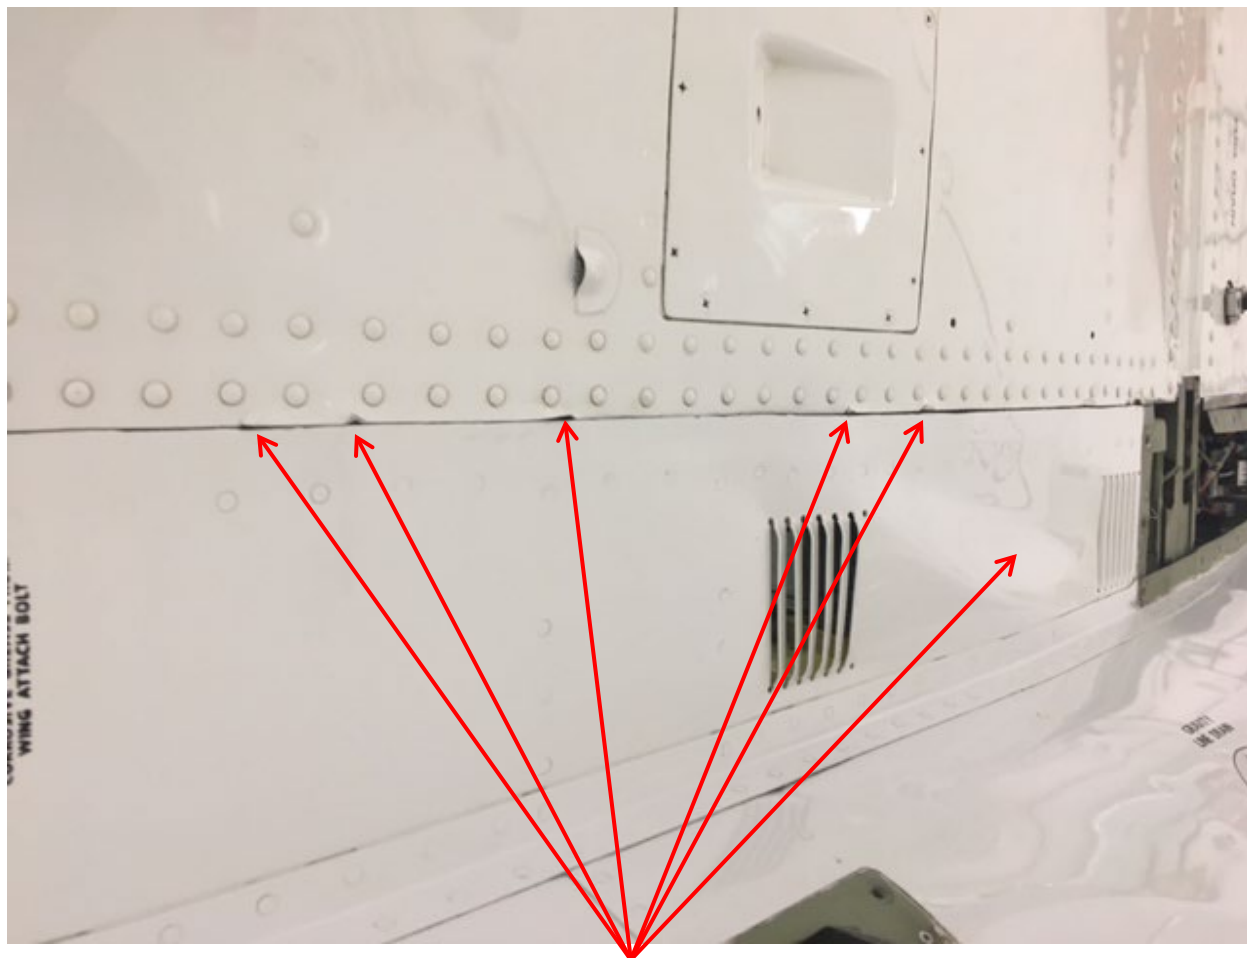


Skin deformation and wrinkles where wing meets center section, Skin on center section was replaced. Skin on wing was re-contoured.

Elliott Aviation of the Quad Cities

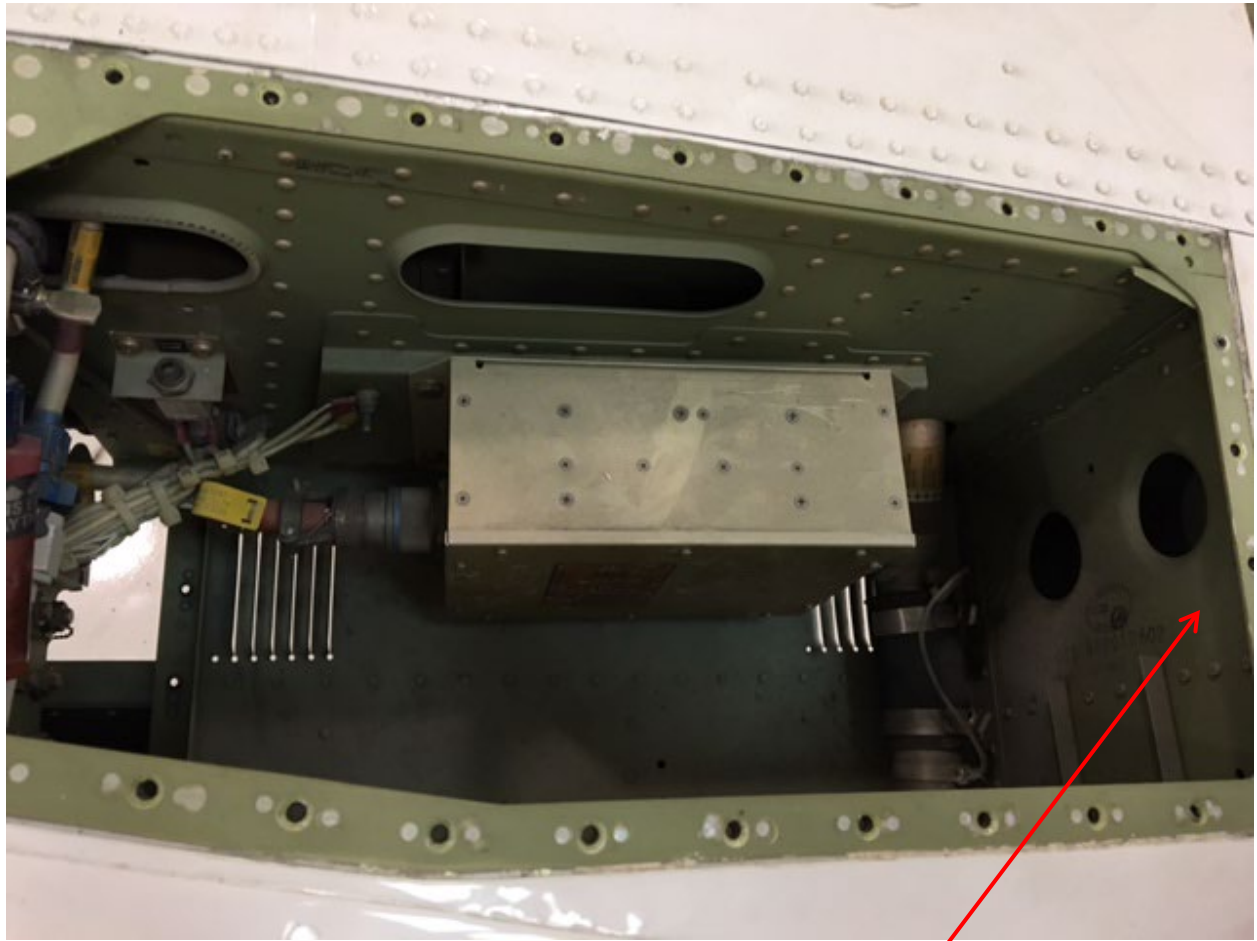

Inverter panel wrinkles. Web replaced.

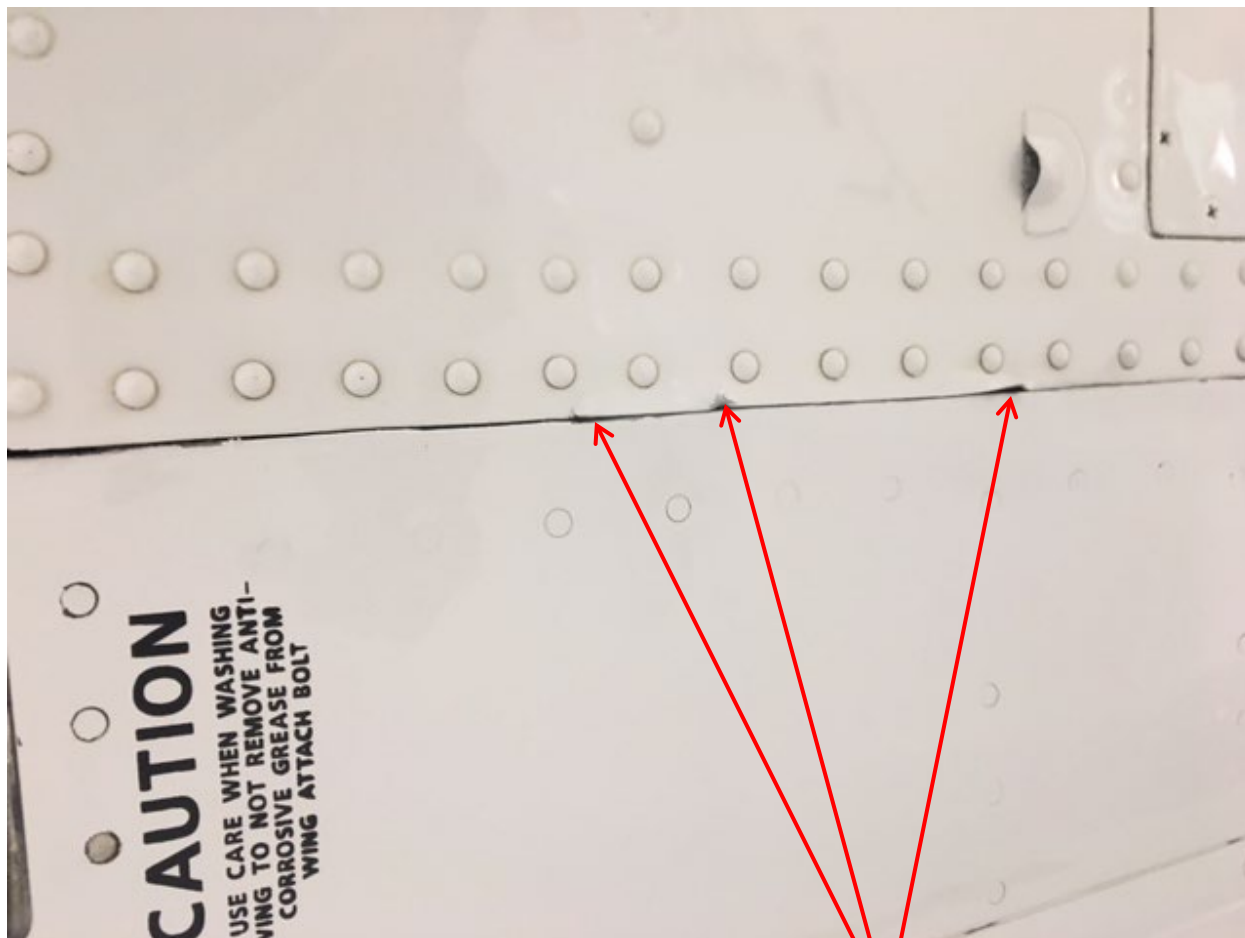

Closer picture of skin deformation.

Elliott Aviation of the Quad Cities



With firewall and keel removed to facilitate keel replacement.

Elliott Aviation of the Quad Cities



In Progress Picture going back together.

Elliott Aviation of the Quad Cities



In-Progress Picture.

Elliott Aviation of the Quad Cities



In-Progress Picture.

Elliott Aviation of the Quad Cities



Complete minus engine and wing.

Elliott Aviation of the Quad Cities



Reassembly. Engine reinstalled and awaiting wing installation 9/6/17.